



Exterior Condition

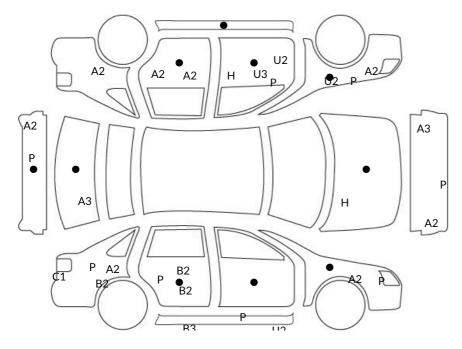

Legend

A1:Small Scratch P: Paint marked U2:Dent U1:Small Dent A3:Big Scratch B3: Big Dent with scratch (size like elbow) •: Minor Scratches/Dents



Body Frame Accident Checklis	st		100%
Radiator Core Support	Non-Accidented	Boot Floor 9	Non-Accidented
Right Strut Tower Apron 9	Non-Accidented	Boot Lock Pillar	Non-Accidented
Left Strut Tower Apron 9	Non-Accidented	Rear Sub Frame	Non-Accidented
Right Front Rail 9	Non-Accidented	Front Sub Frame 9	Non-Accidented
Left Front Rail 9	Non-Accidented		
Cowl Panel Firewall 9	Non-Accidented		
Right A Pillar 9	Non-Accidented		
Left A Pillar 9	Non-Accidented		
Right B Pillar	Non-Accidented		
Left B Pillar 9	Non-Accidented		
Right C Pillar 9	Non-Accidented		
Left C Pillar 9	Non-Accidented		

Fluids/filters check		Exhaust check	
Engine Oil Level	Complete and Clean	Exhaust Sound O	Ok
Engine Oil Leakage 9	Leakage		1
Transmission Oil Leakage 9	No Leakage	Engine cooling system	
Coolant Leakage	No Leakage	Radiator	Ok
Brake Oil Leakage	No Leakage	Suction Fan 9	Working
Mechanical check	- 	Transmission check / power train	
Belts (Fan) O	Ok	Engine electronics	
Wires (Wiring Harness)	Ok	Starter Operation	Ok
Engine Blow (Manual Check) 9	Not Present		
Engine Noise 9	No Noise		
Engine Vibration 9	No Vibration		
Cold Start	Ok		
Engine Mounts	Ok		
Pulleys (Adjuster) O	Ok		
Hoses	Ok		
Brakes			100%

Brakes

Mechanical check	
Front Right Disc	Smooth
Front Left Disc	Smooth
Front Right Brake Pad	More than 50%
Front Left Brake Pad	More than 50%
Parking / Hand Brake	Ok

Suspension/Steering

92%

Front suspension	
Steering Wheel Play	Ok
Right Ball Joint	Ok
Left Ball Joint	Boot Damage or Play
Right Z Links	Boot Damage or Play
Left Z Links	Boot Damage or Play
Right Tie Rod End	Ok
Left Tie Rod End	Ok
Front Right Boots	Ok
Front Left Boots	Ok
Front Right Bushes	Damaged
Front Left Bushes	Damaged
Front Right Shock	Ok
Front Left Shock	Ok

Rear suspension	
Rear Right Bushes	No Damage Found
Rear Left Bushes	No Damage Found
Rear Right Shock	Ok
Rear Left Shock	Ok

Interior

Steering controls

Steering Wheel Condition	Scratched
Horn	Working
Lights Lever / Switch (High / Low Beams , Indicators)	Working
Wiper / Washer Lever (Washer, Speeds)	Working

Mirrors

Right Side Mirror	Working
Left Side Mirror	Working
Rear View Mirror Dimmer	Showing Reflection

Seats

Right Seat Adjuster Recliner	Working
Left Seat Adjuster Recliner	Working
Right Seat Adjuster Lear Track	Working
Left Seat Adjuster Lear Track	Working
Right Seat Belt	Working
Left Seat Belt	Working
Rear Seat Belts	Working
Glove Box	Working

90%

	5
Front Right Power Window/Manual Lever	Working Properly
Fornt Left Power Window/Manual Lever	Working Properly
Rear Right Power Window/Manual Lever	Working Properly
Rear Left Power Window/Manual Lever	Working Properly
Auto Lock Button	Working
Window Safety Lock	Working
Dash / roof controls	
Dash / roof controls Interior Lightings	Working
	Working Working
Interior Lightings	
Interior Lightings Dash Controls - A/C	Working
Interior Lightings Dash Controls - A/C Dash Controls - De-Fog	Working Working
Interior Lightings Dash Controls - A/C Dash Controls - De-Fog Dash Controls - Hazzard Lights	Working Working Working

Working

Working

Working

Power / manual windows & central locking

Trunk Release Lever / Button

Fuel Cap Release Lever / Button

Bonnet Release Lever / Button

Poshish	
Roof Poshish	Dirty
Floor Mat	Perfect
Front Right Seat Poshish	Not Checked due to Market Cover
Front Left Seat Poshish	Not Checked due to Market Cover
Rear Seat Poshish	Not Checked due to Market Cover
Dashboard Condition	Perfect

Equipment	
Spare Tire	Present
Tools	Complete
Jack	Present

Ac/Heater

Ac / heater check up	
AC Fitted	Yes
AC Operational	Yes
Blower	Excellent Air Throw
Cooling	Excellent
Heating	Excellent

100%

Electrical & Electronics

Electrical & Electronics			100%
Computer check up		Battery	
Computer Check up / Malfunction	No Error	Voltage 9	12
Check 9		Terminals Condition	Ok
Battery Warning Light	Not Present	Charging	Ok
Oil Pressure Low Warning Light	Not Present		-
Temperature Warning Light / Gauge	Not Present	Alternator Operation	Ok
Power Steering Warning Light	Not Present	Instrument cluster	
ABS Warning Light	Not Present	Gauges	Working

🖚 Exterior & Body

Car frame

Trunk Lock	Ok
Front Windshield Condition	Chip
Rear Windshield Condition	Scratches
Front Right Door Window	Ok
Front Left Door Window	Ok
Rear Right Door Window	Ok
Rear Left Door Window	Ok
Windscreen Wiper	Cleaning Properly

47%

Exterior lights	
Right Headlight (Working)	Working
Left Headlight (Working)	Working
Right Headlight (Condition)	Cracked or Broken
Left Headlight (Condition)	Cracked or Broken
Right Taillight (Working)	Working
Left Taillight (Working)	Working
Right Taillight (Condition)	Perfect
Left Taillight (Condition)	Perfect
Fog Lights (Working)	Working

🛞 Tyres

Tyres		Tyres
Front Right Tyre Brand	Continental	Wheel Caps
Front Right Tyre 9	5.8mm (remaining tread)	
Front Left Tyre Brand	Continental	
Front Left Tyre 9	5.6mm (remaining tread)	
Rear Right Tyre Brand	Continental	
Rear Right Tyre O	6.6mm (remaining tread)	
Rear Left Tyre Brand	Continental	
Rear Left Tyre 9	6.6mm (remaining tread)	
Tyre Size	196/65/R15	
Rims	Alloy	

77%

👗 Test Drive

Engine Pick	Ok	Test Drive Done By
Drive Shaft Noise	No Noise	
Gear Shifting (Automatic)	Smooth	
Brake Pedal Operation	Timely Response	
ABS Operation	Timely Response	
Front Suspension (While Driving)	No Noise	
Rear Suspension (While Driving)	No Noise	
Steering Operation (While Driving)	Smooth	
Steering Wheel Alignment (While Driving)	Centered	
AC Operation (While Driving)	Perfect	
Heater Operation (While Driving)	Perfect	
Speedometer (While Driving)	Working	





Front View

Oblique Front - Right



Oblique Rear – Right

Rear View



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.





Oblique Rear – Left



Oblique Front – Left






Engine No



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.

Chassis No



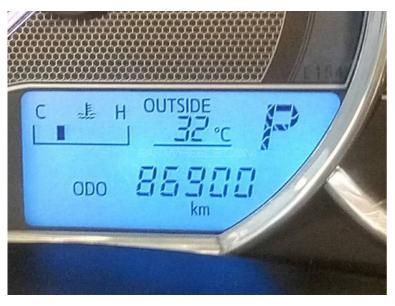

Odometer



Engine Compartment







Front Interior



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.



PakWheels Lahore





Rear Interior

Tool kit/Spare tyre



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.



PakWheels Lahore



Trunk Open

4 Way Switch



Key/Remote



Tyre



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.





Rear Package Tray

Rear Package Tray



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.







Rear Package Tray

Rear Package Tray



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.







Rear Package Tray

Rear Package Tray



2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore.



PakWheels Lahore





Rear Package Tray

Rear Package Tray

2nd Floor, Saeed Alam Tower, 37 Commercial Zone, Liberty Market, Lahore. www.pakwheels.com, info@pakeventures.com 042 111 WHEELS (943 357) /pakwheels

Comments

left C paller painted. tyres par creck han. rims par scratches han. front crome grill damage.

Disclaimer:

In case of any query or concern regarding inspection please call 042 - 111 WHEELS (042- 111 943 357).

This report is based on the condition of the vehicle on the date of certification and provides an approximate estimate of the condition on that date. Except where indicated, the parts were in working condition - this report does not take into account the condition of parts not visible or not inspected. PakWheels.com has relied on the odometer reading for kms driven as seen at the time of inspection and is not responsible for verifying its genuineness. The report is in no way a commitment on the condition of the car. All reports are subjective and PakWheels.com and its associates cannot be held liable in any way due to the use of this report.

Unless mentioned by the dealer, cars with W1 grade paint cannot be detected by the human eye, hence it can be possible for such paint to go undetected.